Tigrip® Load Hoisting Tackle Permanent load lifting magnets



In order to achieve a maximum capacity, the contact surface should be bright and free from dirt, oil, grease, scale, corrosion, paint etc.

Permanent load lifting magnets model TPM

Capacity

100 - 2000 kg (Flat material),

50 - 1000 kg (Round material)

TPM load lifting magnets are ideal tools for easy, quick and thus economical transport of heavy objects made of ferro-magnetic material. Typical operating areas are workshops and warehouses, loading and unloading of machines as well as construction of jigs and fixtures.

Compact design of the units for a large number of applications.

The load is not affected mechanically which allows lifting of flat as well as round material. The efficient magnet body provides strong lifting capacity at low dead weight. The permanent magnets do not require electric energy and will leave only minor residual magnetism on the material after use.

The magnets are activated / deactivated easily by turning a locking lever. In activated condition the hand lever will be safely locked and thus prevent unintended demagnetising.

The selection of the appropriate magnet model should be made under consideration of the varying conditions of the contact surface, kind of material alloy and plate thickness/bar diameter (see table).





Technical data model TPM

Model	EAN-No. 4025092*	Flat material capacity** max.	Material thickness min. at max. capacity	Flat material length of material max.	Round material capacity** max.	Round material diameter	Round material length of material max.	Test load	Weight
		kg	mm	mm	kg	mm	mm	kg	kg
TPM 0,1	*558853	100	14	2000	50	200 - 300	2000	300	6.8
TPM 0,3	*558860	300	20	2500	150	200 - 300	2500	900	15.5
TPM 0,5	*558877	500	24	3000	250	200 - 400	3000	1500	30.6
TPM 0,8	*558884	800	34	3500	400	200 - 400	3500	2400	56.0
TPM 1,0	*558891	1000	40	3500	500	200 - 400	3500	3000	61.0
TPM 2,0	*190367	2000	55	3500	1000	200 - 400	3500	6000	126.0

^{**}gemessen auf ziehblankem Material St 37

Dimensions model TPM

Model	TPM 0,1	TPM 0,3	TPM 0,5	TPM 0,8	TPM 1,0	TPM 2,0
A, mm	122	192	232	302	332	392
B, mm	69	95	120	154	154	196
C, mm	185	225	270	320	320	420
D, mm	160	250	250	450	450	450

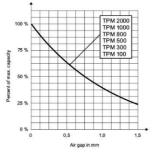


Diagram: WLL/air gap



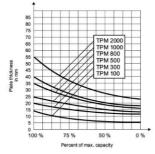


Diagram: WLL/material thickness

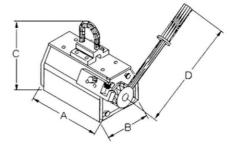


Model TPM

Reduction of capacity

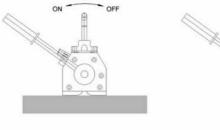

Correct use On/Off

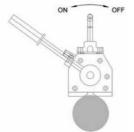

capacity				
100%				
100%				
95%				
80%				
70%				
45%				
45%				
0 %				
0 %				
0%				





